

# EC700

## Modbus Gateway



The modbus gateway is part of the InfraLINK range of network infrastructure components from partners.

All of the modbus gateways feature a robust hardware platform with high performance CPU and UART for fast communications without loss of data. The LonWorks to modbus address mapping is pre-loaded and ready for use with the CF3000 fire system interface board.

The EC700 modbus gateway has 3 communications ports for LonWorks, serial and programming connections. The serial port is capable of either RS232 or RS485 (2-wire) communications.


### Benefits

- High speed host processor with LonWorks Neuron communications co-processor
- Echelon Smart Transceiver for better immunity from magnetic and high frequency common mode noise
- Robust high speed UART for serial communications
- Compact design for easy installation
- 6 multi function LED indicators for instant status diagnostics
- Saves time by allowing simple integration with 3rd party modbus BMS system
- Easy to install
- Din rail mounted

## Technical Specification

Code	EC700
Description	Modbus Gateway - LonWorks Transceiver FT-X1 (Smart Transceiver), TP/FT-10 (use on free topology twisted pair channel)
<b>Specification</b>	
Baudrate	78 kbit/s
Connections	1 x 2-pole wieland connector
Supply Voltage / Mains Connector	24V dc ± 10% 50Hz
Current Consumption	Max 280mA on 24V dc (typically 100mA)
Serial Communications	Modbus RTU slave
Transceiver	RS232 / 422 (4-wire) / 485 (2-wire)
Baud Rate	Configurable up to 576 kbits/s
Connector	DSUB-9 female connector
<b>Environmental</b>	
Operating Temperature	0°C to + 55°C Non Operating Temperature -5°C to +85°C Physical
Dimensions (L x H x W)	120mm x 27mm x 75mm
Weight	150g
Ingress Protection	IP20
EMC Certification	CE marked, UL & cUL conformance

## Installation

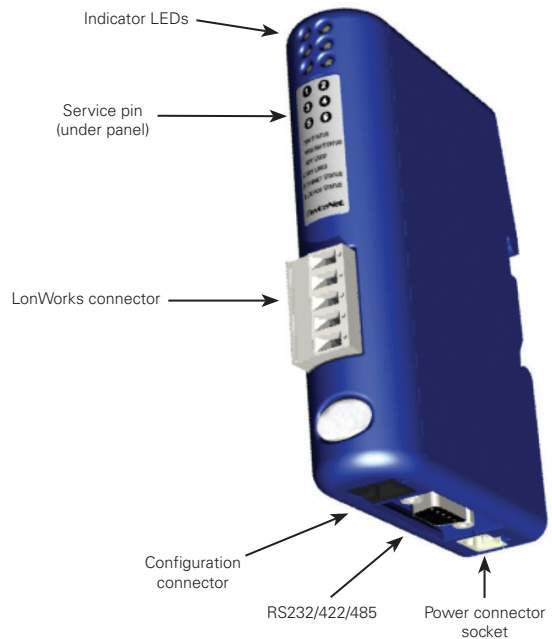


## Installation

LED No.	Description	Colour	State	Function
1	LON Service	Green	Flashing Green	Unconfigured.
			Off	Configured
			Solid Green	Applicationless
2	LON Wink	Red	Off	Normal state
			Flashes Red	A Wink command is received
3	Not used	-		
4	Module Status	Green/Red	Solid Green	The module is working ok.
			Flashes Red	Software error, try a reset.
			Solid Red	Hardware error
5	Module Activity	Green/Red	Solid Red	No Modbus activity for 5 secs.
			Solid Green	After receiving a correct Modbus message
6	Config Error	Green/Red	Solid Green	Config good
			Flashes Red	No Config




### Pin Description

Pin	Description
1	+24V dc
2	GND



Pin	Description	RS232	RS422	RS485
1	+5V	✓	✓	✓
2	RS232 Rx	✓		
3	RS232 Tx	✓		
4	Not connected			
5	Ground	✓	✓	✓
6	RS422Rx +		✓	
7	Rs422 Rx -		✓	
8	RS485 + / RS422 Tx +		✓	✓
9	RS485 - / RS422 Tx -		✓	✓



### Pin Description

Pin	Description
1	Shield
2	-
3	-
4	Net B
5	Net A

## Coopers BMS interface for Modbus:

### Default Serial Parameters:

Transceiver: RS232, TX, RX, GND (Note NULL modem cable plus gender changer required for PC connection).

Communications: 9600 bits per second, 8 data bits, 1 stop bit, no parity.

Note: A PC configuration tool is available to change serial parameters.

Register Name	Length (bytes)	Modbus Type	Modbus Address
<b>Control Registers</b>			
Command *	2	Holding (16-bit)	1
Event Timer	2	Holding (16-bit)	2
Event Count **	2	Input (16-bit)	26
Buffer Overflow ***	2	Input (16-bit)	24
<b>Fire Event Registers: The Coopers Fire Event has been split into a number of individual Modbus registers</b>			
Command or Status	2	Input (16-bit)	1
Status Number	2	Input (16-bit)	2
Address	2	Input (16-bit)	3
Analogue	2	Input (16-bit)	4
Zone	2	Input (16-bit)	5
Loop	2	Input (16-bit)	6
Type Id	2	Input (16-bit)	7
Location	31	Input (16-bit)	Aug-23
Panel	2	Input (16-bit)	25


\* Command (Holding Reg. 1) usage 0 = Not Used, 1 = Evacuate, 2 = Silence, 3 = Reset

\*\* Event Count (Input Reg. 26) increments by one, each time a new Fire Event is presented on the Modbus Fire Event Registers. A BMS system can look for a Change Of Value (COV) on this register as a signal to read the Fire Event Registers.

\*\*\* Buffer Overflow (Input Reg. 24) increments when the message queue in the Coopers LonWorks BMS interface is full while a new event arrives from a fire panel. This can happen when Fire Events occur at a rate faster than the Event Timer for a prolonged time.

Note: The value of the Event Timer (Holding Reg. 2) is a 16-bit integer of 0-65535, where 1 = 0.1 seconds.

## Standard Connections

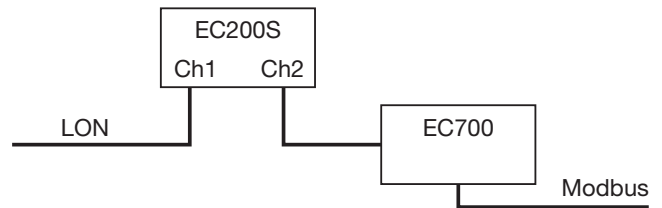

## Catalogue numbers

Description	Code
Modbus Gateway	EC700

**Eaton**  
Electrical Sector EMEA  
Route de la Longeraie 7  
1110 Morges, Switzerland

**Eaton**  
**Fire Systems Business**  
Cooper Lighting and Safety Ltd  
Wheatley Hall Road  
Doncaster  
South Yorkshire  
DN2 4NB  
United Kingdom  
Tel: +44 (0)1302 303 999  
Fax: +44 (0)1302 303 333  
Email: sales@cooperfire.com  
Web: www.cooperfire.com

© 2014 Eaton  
All Rights Reserved  
Pub Reference: FDS031  
September 2014

Changes to the products, to the information contained in this document, and to prices are reserved; so are errors and omissions. Only order confirmations and technical documentation by Eaton is binding. Photos and pictures also do not warrant a specific layout or functionality. Their use in whatever form is subject to prior approval by Eaton. The same applies to Trademarks. The Terms and Conditions of Eaton apply, as referenced on Eaton Internet pages and Eaton order confirmations.

Eaton is a registered trademark. All other trademarks are property of their respective owners.